

# C.V RAMAN POLYTECHNIC, BHUBANESWAR DEPARTMENT OF MECHANICAL ENGINEERING MECHANICAL ENGINEERING LAB I



# MECHANICAL ENGINEERING LABORATORY (PRACTICAL-2)

Name of the Course: Diploma in Mech/Auto/Aero & Other Mechanical Allied Branches								
Course code: Semester 3 <sup>rd</sup>								
Total Period:	60	Examination	3 hrs					
Lab. periods:	4 P/week	Sessional	25					
Maximum marks:	75	End Semester Examination:	50					

# 1. Strength of Materials and thermal Laboratory

- 1.1 Determine end reactions in a simply supported beam using parallel force apparatus.
- 1.2 Determination of Young's modulus using Searle's apparatus
- 1.3 Determination of torsional rigidity of the shaft using torsion testing machine
- 1.4 Determination of salient points (Young's modulus, yield point, fracture point) from stress- strain curve using Universal Testing Machine
- 1.5 Determination of hardness number by Rockwell/Vickers hardness testing machine
- 1.6 Determination of toughness using Impact testing machine (Charpy/Izod)
- 1.7 Determination of Flash point and fire point
- 1.8 Joule's experiment

# Mechanical Engineering Laboratory-I (3<sup>rd</sup> semester) Code-Pr-2 Full marks: 75

	Pr.2 Mechanical Engg. Lab-I	Levels
CO1	Learn about simple supported beam, Young's modulus using Searle's apparatus.	2
CO2	Determine torsional rigidity with salient points from stress-strain curve using UTM.	3
CO3	Determine hardness number and toughness of MS.	3
CO4	Calculate flash point, fire point and Joule's experiment.	3

# **CO-PO Mapping**

Course	PO1	PO2	PO3	PO4	PO5	PO6	PO7	Average CO
CO1	3.00	2.00	1.00	1.00	-	-	-	1.75
CO2	3.00	2.00	1.00	1.00	-	-	-	1.75
CO3	3.00	2.00	1.00	-	-	-	-	2.00
CO4	3.00	2.00	2.00	1.00	1.00	-	-	1.80
Average PO	3.00	2.00	1.25	_	1.00	-	-	1.83

# Sessional Rubrics (25)

	At	tendance (	3)		Record (5)		Expe	riment/Job	(12)		Viva (5)	
	The student attends all the classes.			details and good communication skills, refers to the slides to explain the points and completely			The seminar report is accroding to the specified format. The content is written with clarity and in organized manner. There is a logical flow in the text.			Ü		
Rating/Perf ormance criteria	12	11	10	9	8	7	6	5	4	3	2	1
Attendance (3)										Fulfills to 100% of set criteria	Fulfills to 70% of set criteria	Fulfills to 50% of set criteria
Record (5)								Fulfills to 100% of set criteria	80% of set	Fulfills to 60% of set criteria	Fulfills to 50% of set criteria	Fulfills to 30% of set criteria
Experiment/ Job (12)	set criteria 9		Fulfills to 90% of set criteria		Fulfills to 70% of set criteria	Fulfills to 60% of set criteria	Fulfills to 50% of set criteria	Fulfills to 40% of set criteria	Fulfills to 30% of set criteria			
Viva (5)								Fulfills to 100% of set criteria	80% of set	Fulfills to 60% of set criteria	Fulfills to 50% of set criteria	Fulfills to 30% of set criteria

# **Sessional**

Mechanical Engineering Laboratory-I (3<sup>rd</sup> semester) Code-Pr-2 Full marks: 25

Sl. No.	Name of student	Registration number	Attendance (3)	Record (5)	Experiment (12)	Viva (5)	Total (25)

		Re	port (15)			Experim		Viva (10)					
	Report is w	vell written. T	he Contents a	are equipped	with Identi	ying equipme	s and A	A set of questions is asked relating to the					
		tch, error free				material and setting up of machine tool.				experiment and subject.			
		gramm	atical errors.		Exhibi	Exhibits proper knowledge of the lab							
					procee	ture. Runs the							
					-	-	es all the read	_					
							during experi						
							is calculated						
							nalyses if any						
							eason. The ex	-					
	is completed within taking proper safety												
					"		s is maintaine						
						ming the expe		u ********					
Rating/Performanc	25	24	21	18	15	12	10	8	6	4	2		
e criteria													
Report (15)					Answers to		Answers to	Answers to		Answers			
					100% of	75% of	60% of	50% of		to 30% of			
					questions asked			questions asked	questions asked	questions asked			
					asked	asked	asked	asked	asked	asked			
Experiment/Job	Performs	Performs	Performs	Performs	Performs	Performs	Performs	Performs 309	%				
(25)	100% of	90% of the	80% of the	70% of the	60% of the	50% of the	40% of the	of the criteri	a				
	the criteria	criteria	criteria	criteria	criteria	criteria	criteria						
Viva (10)							Answers to	Answers to		1			
							100% of	90% of		to 50% of			
							questions	questions	questions	1 *	questions		
							asked	asked	asked	asked	asked		

# **Practical**

Mechanical Engineering Laboratory-I (3<sup>rd</sup> semester) Code-Pr-2 Full marks: 50

Sl. No.	Name of student	Registration number	Report (15)	Experiment/Job (25)	Viva (10)	Total (50)

Programme outcomes (POs) and Programme specific outcomes (PSOs) to be achieved through the practical of this course: -

- Basic and Discipline specific knowledge: Apply knowledge of basic mathematics, science and engineering fundamentals and engineering specialization to solve the engineering problems.
- 2. **Problem analysis:** Identify and analyze well-defined engineering problems using codified standard methods.
- Design/development of solutions: Design solutions for well-defined technical problems and assist with the design of systems components or processes to meet specified needs.
- 4. **Engineering Tools, Experimentation and Testing:** Apply mode m engineering tools and appropriate technique to conduct standard tests and measurements.
- 5. Engineering practices for society, sustainability and environment: Apply appropriate technology in context of society, sustainability, environment and ethical practices.
- 6. **Project Management:** Use engineering management principles individually, as a team member or a leader to manage projects and effectively communicate about well-defined engineering activities.
- 7. **Life-long learning:** Ability to analyses individual needs and engage in updating in the context of technological changes.

# **Program Specific Outcomes (PSOs)**

PSO-1	Discipline knowledge	Demonstration and understanding of tools with advanced software for design specification and operation of Mechanical Engineering systems, components and processes.
PSO-2	Professional Skills	Apply contextual knowledge to analyze social, environmental, health, safety, legal, and cultural issues with professional ethics as part of the lifelong learning process. To be equipped to lead a team or operate successfully alone as an individual managing tasks in transdisciplinary areas.

# INDEX List of practical and progressive assessment sheet

Sl. No.	Title of experiment	Date of experiment	Date of Submission	Remarks
1	Determine end reactions in a simply supported beam using parallel force apparatus.			
2	Determination of Young's modulus using Searle's apparatus			
3	Determination of torsional rigidity of the shaft using torsion testing machine.			
4	Determination of salient points (Young's modulus, yield point, fracture point) from stress- strain curve using Universal Testing Machine.			
6	Determination of hardness number by Rockwell/Vickers hardness testing machine.			
7	Determination of toughness using Impact testing machine (Charpy/Izod).			
8	Determination of Flash point and fire point.			
10	Joule's experiment			

# **EXPERIMENT NO.1**


# **Aim of the experiment:**

Determination of end reactions in a simple supported beam using parallel force apparatus.


# Theoretical back ground:

If a system of coplanar for acting on a rigid body, keep it in equilibrium then the algebraic sum of their moments about any point in their plane is zero.

Consider a beam simply supported at the ends and carrying many concentrated loads Taking moments about  $R_{\mathrm{b}}$  we get

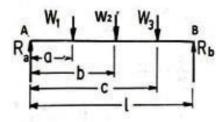

# **Experimental set up:**

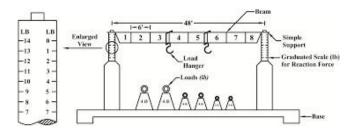

#### **Resources required:**

Sl.no	Name of	Specification
	the	_
	apparatus	
1	Parallel force apparatus	Consisting of two digital weighing machine, steel bars with grooves for hanging weight. Complete with wooden scale, hooks and weights.
2	weights	100/500gms steel weights
3	Hangers	2 Nos

# **Procedure:**

- 1. Measure the distance L
- 2. Note the zero error in the compression balances.
- 3. Place the be am on digital weighing balances and reset the weighing scale reading to zero.
- 4. Suspend different loads W1, W2&W3 at a distance a, b & c
- 5. Note the reaction on the beam given by the readings of compression balances (ra&rb)
- 6. Calculate Ra&Rb values from equation(1)and(2).
- 7. Repeat the experiment by taking different positions of W1,W2&W3.
- 8. Find out %error between calculated and observed reading.

# **Precautions:**

- 1. Zero error of the compression balance must be taken into account.
- 2. Weights should not be put on the beam with a jerk.
- 3. Slightly press the beam to remove any frictional resistance at the supports before taking the readings.
- 4. All the distances a ,b, can should be measured accurately.
- 5. Reading so spring balances at A&B should be taken accurately.

# **Observations:**

SL N O	Weights on be a man their distance from point A					Final readin & B	g at A	Reactions to calculation		%Erro Ra&R		
	W1	W2	W3	a	b	С	ra	rb	Ra calculated	Rb calculated	%Er ror Ra	%Er ror Rb
1												
2												
3												

# **Conclusions:**

The end reactions for simple supported beam (actual) is found to be	The end reactions
for simple supported beam (actual)is found to be	

# **EXPERIMENT NO .2**

# **<u>Aim of the experiment:</u>**

Determination of Young's Modulus using Searl's Apparatus.

# Theoretical back ground:

#### Stress:-

It is defined as the ratio between the load and cross-sectional area of the given specimen .It may be defined as force per unit area.

Mathematically,

Stress=load/area,  $\sigma$ = (P/A)

Unit of stress is N/M<sup>2</sup> or KN / M

**Strain:** It is define as the ratio between the change in the length to its original

length of the given specimen.

Mathematically,

Strain=change in length /original length

e =It has no unit.

# Young's modulus: -

It is the ratio between stress and strain. Sometimes referred to as the modulus of elasticity. It is a mechanical property that measures the stiffness of a solid material. It quantifies the relationship between tensile stress and axial strain in the linear elastic region of a material.

Mathematically,

Young's modulus=stress/strain = $E=\sigma/e$  Its unit is


 $KN/M^2$  or  $N/M^2$ .

# **Experimental set up:**

# **Technical Specification:**

Diameter of copper wire(d)=  $m^2$ 

Original Length of copper wire (L)= m

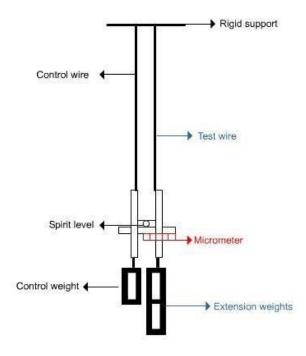

**SEARL'SAPPARATUS** 

# **Resources required:**

SLNO.	NAMEOFTHEAPPARATUS	SPECIFICATION
01	Searl's apparatus	
02	Vernier caliper	L.C=0.02mm
03	Steel rule	L . c =0.5mm
04	Copper wire	D =0.001mm
05	Balancing weight	1Kg
06	Weight pan	
07	Plier	

# **Procedure: -**

- 1. Take two copper wire so frequent site length.
- 2. Hang the Searl's apparatus by the two copper wires of which one wire is fixed wire and another is testing wire.
- 3. Now measure the diameter and length of the wire.
- 4. Then set the weight pan in the testing side.
- 5. Then give some load in the load pan.
- 6. Now writed own the load applied and the change in length in the observation AW table.
- 7. Then gradually increase the loads and take at least five readings.

# **Precautions if any:**

- 1. Weight (load) should be applied gradually.
- 2. Always maintain the spirit level horizontal with the base
- 3. Avoid errors during measurement of length, diameters, etc.
- 4. Over loading should be avoided.

## **Observation table and calculation:**

SL.NO	Load applied(P)kg	Stress(ρ) (P/A)	Change in length(ΔL)	Strain(e) (ΔL/L)	Young's modulus(σ/e)
			m		
1					
2					
3					
4					
5					

<b>Conclusion</b> : young's	s modulus of	the given	specimen	is	found to	be
-----------------------------	--------------	-----------	----------	----	----------	----

# **EXPERIMENT NO.3**

# Aim of the experiment:

Determination of torsional rigidity of the shaft using torsion testing machine

# **Theoretical back ground:**

Materials commonly used in the manufacturing industry, such as metal fastener sand beams are often subjected to torsion; hence determination of their strength under twisting is necessary. Without torsion test, materials would not be properly vetted before being launched for commercial use. In torsion test the measurable values include the modulus rigidity, yield shear strength, ultimate shear strength and modulus of rupture in shear.

The value of modulus of rigidity can be found out through observations, made during the experiment and by using the torsion equation.

The torsion equation is:-

$$T/J=G.\theta/$$

L. So, 
$$G = T.L/J.\theta$$

Where,

T=Torque applied.

J=Polar moment of inertia= $\frac{\pi d^4}{32}$ 


d=Diameter of specimen.


C=Modulus of rigidity.

 $\theta$  =Angle of twist.

L=Gauge length of the specimen in m.

# **Diagram/setup:**

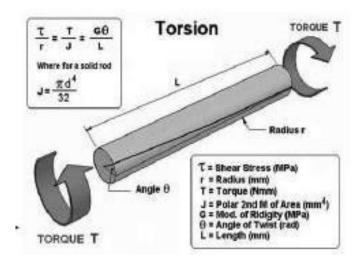

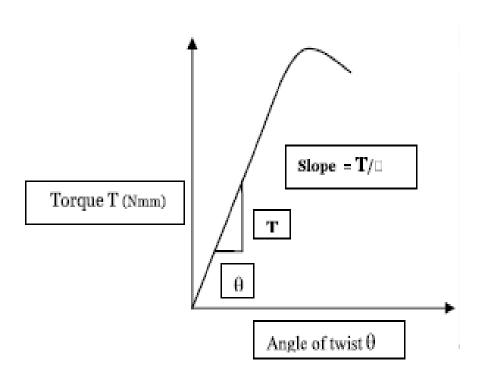

# **Recourses required:**

Sl	Name of	Broad specification
.no	the apparatus	
01	Torsion testing machine	Make: En kay .Max. torque capacity: 200.Torque range: 200,100,50. No of divisions on dial: 500.Clearance between grips: 0-420mm. Grips for round specimen: 7-10,10-15,15-20mm. Grips for flat specimen width: 3-10,30mm. Motor: 440v/3 phase/50HZ/0.5HP. Fixed with auto torque selector to regulate torque ranges, contains geared motor to apply torque to specimen. Torsion and twist test on various metal rods and flats, torque measurement by pendulum dynamometer system. One of the grips shall be capable of being rotated around the axis of the test piece while the others hal no be subjected to any angular deflection. The distance Between the grips shall be capable of adjustment for different lengths.
02	Mild steel specimen	D= L=
03	Steel rule	Least count=0.5mm
04	Vernier caliper	Least count=0.02mm

# Procedure: -

- 1. Select the driving dogs to suit the size of the specimen and clamp it in the machine by adjusting the length of the specimen by means of a sliding spindle.
- 2. Measure the diameter of the specimen at about three places and take the average values.
- 3. Choose the appropriate range by capacity change lever.
- 4. Set the maximum load pointer to zero.
- 5. Set the protractor to zero for convenience.
- 6. Carry out straining by rotating one of the ends with hand wheel or electric motor in either direction.

- 7. Record there adding soft or que and angle of twist  $(T_{\bullet})$
- 8. Continue to test the sample for the destruction with increasing values of strain. Record the values of T& up to fracture.
- 9. Plota torque verses angle of twist graph.
- 10. Read of coordinates of a convenient point from the straight-line portion of the graph and calculate the value of the modulus of rigidity by using torsion equation.

# **Precautions to be followed:**

- 1. Avoid over acceleration of machine and maintain proper rate of loading.
- 2. Place the sample exactly at their quired location only and fix properly.
- 3. Keeps distance from the machine during operation
- 4. The grips having requisite hardness and straight faces must be used.
- 5. The grips should not apply any bending or to the test specimen.

Observations and calculations:
Material of the sample:
Diameter of the sample,
d1=mm, d2=mm, d3=mm
Average dia. = mm
Gauge length of the sample=mm

# **Observations during experiments:**

Sl. No.	Torque(T) in N-mm	Angle of twist( )	
		□in degrees	□in radians

amnle	calcu	lations:
ampic	carcu	iauviis.

Polar moment of inertia(J)= $\frac{\pi \overline{d}^4}{32}$ =.....mm<sup>4</sup>

Plot T v s graph from above reading sand find out the lope of the graph (in elastic region)

From torsion equation, we know that  $\bar{G} = T.L/J$ .

 $G = (slope\ of\ the\ graph\ T\ \bar{\mathbb{V}} \, s\ )\ x\ (L/J) {=} ..... N/mm^2$ 

**Conclusion:** modulus of rigidity of given sample specimen is found to be.....

#### **EXPERIMENT NO.4**

# Aim of the experiment:

Determination of Salient points (Young's Modulus, Yield Point, Fracture point) from stress – strain curve using Universal Testing Machine (UTM).

# **Theoretical back ground:**

The tensile test is most applied one, of all mechanical tests. In this test ends of test piece are fixed into grips connected to a straining device and to a load measuring device. If the applied load is small enough, the deformation of any solid body is entirely elastic. An elastically deformed solid will return to its original form as soon as load is removed. However, if the load is too large, the material can be deformed permanently. The initial part of the tension curve (stress- strain curve) which is recoverable immediately after unloading is termed as elastic zone and the rest of the curve which represents the manner in which solid undergoes plastic deformation is termed plastic zone. The stress below which the deformations essentially entirely elastic is known as the yield strength of material. In some material the onset of plastic deformation is denoted by a sudden drop in load indicating both an upper and a lower yield point. However, some materials do not exhibit a sharp yield point. During plastic deformation, at larger extensions strain hardening cannot compensate for the decrease in section and thus the load passes through a maximum and then begins to decrease. This stage the "ultimate strength" which is defined as the ratio of the load on the specimen to original cross-sectional area, reaches a maximum value. Further loading will eventually cause 'neck' formation and rupture.

**Stress:** when a material is subjected to external loading, then the internal resistance per unit cross section, set up in the material to deformation is called as stress.

**Ultimate tensile strength** of a material is maximum load carrying capacity of the material per unit cross sectional area in tension.

**Tensile strain:** change in length /original length.


**Hooke's law:** within elastic limit, stress is directly proportional to strain.


**Modulus of elasticity:** the ratio of stress to strain with in elastic limit.

**Percentage of elongation:** the percentage change in gauge length with reference to the original gauge length.

**UTM machine** is designed for testing metals and other materials under tension, compression, bending, transverse and shear loads. The Straining/Loading Unit consists of a hydraulic cylinder, an electrical geared motor coupled to a chain sprocket drive and a table coupled with the ram of the hydraulic cylinder mounted on a robust and rigid cast iron base. The cylinder and the ram are individually lapped to eliminate friction. The upper cross-head is rigidly fixed to the table by straight, hard chrome plated steel columns. The lower cross head is connected to two precisions threaded (screwed) columns which are driven by an A.C. Induction motor

# Block diagram/setup:

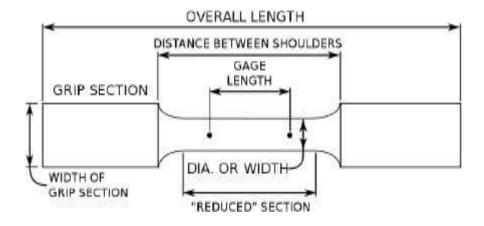

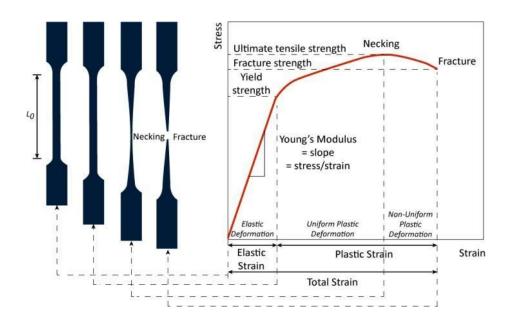

# **Resources required:**

Sl. no	Apparatus	specification
1	Universal Testing Machine	Servo hydraulic fully computerized, capacity: 400kN. Motorized control valve, straining at variable speeds, motor driven threaded column, RS 232 serial port for PC control, measuring range: 0- 400kN, load resolution: 20kN, clearance between columns: 500mm, 440 volt, 50Hz, 3 phase power supply. Hydraulic oil: 67,68 grade,
2	Vernier caliper	l.c= 0.02
3	Steel rule	1.c = 0.5
4	Mild steel specimen	D= L=

#### Procedure:

- 1. Measure the original length and diameter of the specimen. The length may either be length of gauge section which is marked on the specimen with a preset punch or the total length of the specimen.
- 2. Ensurethatthereleasevalveandthecontrolvalvemountedoncontrolunitare closed.
- 3. Puttheelectricswitchon.Movethelowercrossheadupordownwiththehelpof UP/DN press button on control unit to adjust the space with the length of the specimen.
- 4. Insert the specimen into grips of the machine and fix it tightly.
- 5. Put all the required data in software install in PC for the given specimen and save it.
- 6. Begin the load application by pressing the start button on control unit and at the same time click on start button on PC. Slightly open the control valve.
- 7. Record the maximum load. Observe the decrease in load and neck formation on the specimen.
- 8. Record he load at fracture and observe the load vs displacement graph Then switch off the machine.

- 9. Close the control valve and open the lease valve.
- 10. Remove the specimen and observe the cup and cone formation at the fracture point.
- 11. Rejoin the two pieces and measure the final gauge length and reduced diameter.
- 12. Take notes for yield stress, ultimate stress and fracture point stress from the load vs displacement graph.
- 13. Calculate slope of the graph which will give modulus of elasticity.

# **Precautions if any:**

- 1. Avoid over or ding and maintain proper rate of loading.
- 2. Place the sample exactly at the center of the grips of the cross heads.
- 3. Keep safe distance from machine during operation.
- 4. Open the release valve after the machine is switched off.
- 5. Keep distance from electric wires.

$\sim$				4 .		
( )	ns	er	VЯ	ıtı	OI	ns:

(a) Initial diameter of specimen=
(b) Initial gauge length of specimen =
(c) Load at yield point=
(d) Ultimate load=
(e) Breaking load=
(f) Ultimate load after specimen breaking=
(g) Final length after specimen breaks=
(h) Diameter of specimen after breaking takes place=
<u>Calculations:</u>
1. Cross sectional area = $\pi d_{\Delta}^2 \equiv \dots mm^2$
2. Cross sectional area after breaking of specimen=mm <sup>2</sup> 3. Yield stress=yield load/Cross sectional area=N/mm <sup>2</sup>
4. Ultimate stress=ultimate stress/Cross sectional area =
5. Breaking stress=breaking load/Cross sectional area=
7. Stress (with in elastic limit) =N/mm <sup>2</sup>
8. Corresponding strain=
9. Young's modulus=stress/strain=N/mm <sup>2</sup>
Results:

1. Young's modulus=.....

Conclusion:	
From above experiment is successfully completed.	

# **EXPERIMENT NO.5**

# **Aim of the experiment:**

Determination of hardness number by Rockwell hardness testing machine.

# **Theoretical background:**

Rock well hardness test differs from Brinell hardness test in that the hardness is determined from the depth of indentation made by the indenter under a constant load. Various types of indenters may be used in Rockwell hardness tests: diamond indenter and steel-ball indenters of diameter 1/16,1/8,1/4,or1/2inch. In this test, the indenter is pressed into the specimen surface under an initial minor (light) load followed by a major (heavy) load. The additional depth of indentation made by the indenter under the major load beyond that by the minor load is measured and converted to a hardness number.

The hardness number is inversely related to the depth of indentation. In regular Rockwell hardness tests, the minor load is always 10 kg while the major load can be 60,100, or 150 kg. A letter is assigned to each scale that employs a particular combination of indenter and major load. A hardness number is suffixed by first the letter H (for hardness), then the letter R (for Rockwell), and finally the letter that indicates the scale used. For example, a value of 45 on the Rockwell C scale is expressed as 45 HRC.

Rockwell hardness tester gives the direct reading of hardness number on a dial provided with the machine. The specimen may be cylinder, cube, thick or thin metallic sheets.


Type of specimen	Type of <b>Indenter</b>	Scale	<b>Total load(P)</b> Kg-F
Hard Metals	Diamond cone	C (Black graduations)	150
Soft Metals	Ball (1/16")	B (Red graduations)	100

# **Block diagram/setup:**







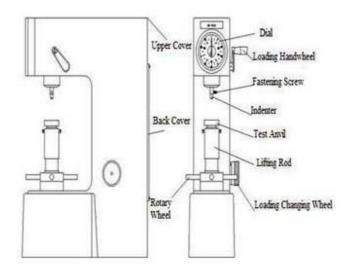

# **Resources required:**

Sl.no	Apparatus	specification
1	Rock well hardness testing machine	
2	Indentor	
3	Weights	
4	Standard specimen	

# **Procedure:**

- 1. Turn power switch located in lower rear panel "ON".
- 2. Select desired scale by means of the "TEST SCALE SCROLL". This key may be depressed for each scale advancement or held in for rapid scrolling.
- 3. Select and install the proper indenter, as indicated in the "PENETRATOR" display.

- 4. Select the proper major load, as indicated in the "MAJOR LOAD kg" display, by means of the weight selector dial.
- 5. Place the specimen on the anvil.
- 6. Raise specimen into contact with the indenter by turning capstan hand wheel clockwise slowly. The bar LEDs (red)will light up and the read display will show "MINORLD".
- 7. Continue to slowly turn the capstan hand wheel. Stop the hand wheel when the bar LEDs reach the "SET" zone. The major load will automatically be applied and then removed. The read display will show "TESTING" and then the numerical value and the scale tested.
- 8. Remove the minor load by turning the capstan hand wheel counter-clockwise. Continue to lower the specimen until it clears the indenter. The test is concluded.

# **Observations:**

S.N	Material	Thickness	Scale	Type of Indenter	Minor Load	Major Load		asure rdnes		Average Rockwell Hardness
					kgf	kgf	1	2	3	
1										
2										
3										

# **Conclusion:**

From above experiment was successfully completed.

#### **EXPERIMENT NO.5**

# **Aim of the experiment:**

To determine the hardness of the given specimen using Brinell hardness test.

# **Theoretical Background:**


The method of hardness testing was introduced by J.A. Brinell in 1900. In this test, a standard hardened steel ball (dia D) is indented into the surface of the specimen by a gradually applied load (P) which is maintained on the specimen for definite time (usually10 or 15 sec). Ball of 10 mm, 5 mm, and 2.5 mm are generally used. The diameter of the impression or indentation (d) is measured by microscope and the Brinell hardness number (B.H.N.) is found out by following formula.


$$BHN = \frac{\textit{Load Applied (kgf)}}{\textit{sperical surface area of indentation}}$$


BHN= 
$$\frac{2P}{\pi D(D-\sqrt{(D^2-d^2)})}$$

# **Experimental setup:**



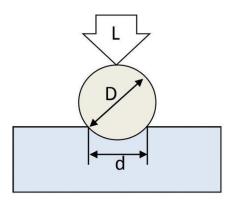

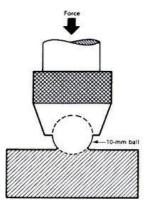

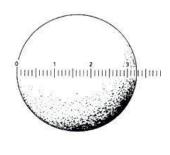

# **Resources required:**

Sl.no	Apparatus	specification
1	Brinell hardness testing machine	Load range: 250kgf up to 3000kgf, max test height: 410mm, depth of throat:200mm, net weight: 500kg, height: 1185mm, size: 650 x 670 mm, drive: electric motor 0.33/0.5 HP, flanged mounted, 440v/50hz/3 phase power supply, max depth of spindle: 180mm, solid vibration free base.
2	Required accessories	Loading pan and loose weights (each equivalent to 250kgf), one testing table, spanner, screw driver, brinell microscope.
3	Indenter	5mm,10mmdiaballindentertype
4	Standard specimen	Mild steel, Al, Cu, etc.

# **Procedure:**

- 1. In set ball of diameter 'D' in the ball holder of machine.
- 2. Make the specimen surface clean by oil, grease, dust etc.
- 3. Make contact between the specimen surface and ball using jack adjusting wheel.
- 4. Push the required button for loading.
- 5. Pull the load release level and wait for 15 seconds.
- 6. Remove the specimen from the support table and locate the Indentation.
- 7. View the indentation through microscope and measure the diameter 'd' of the indentation using micrometer fixed on the microscope.
- 8. Repeat the procedure and take three readings.

# **Precautions:**

- 1. Apply the load slowly and gradually on the sample.
- 2. Distance between old impression and location for new impression should be 3D (three times the ball diameter)
- 3. After applying the specified load waitfor15secthen remove the load.
- 4. The thickness of the test piece must not be less than 8timesthe depth of impression.
- 5. The surface on which the Brinell impression is to be made should be sufficiently smooth and clean.

# **Observations:**

S.N.	Test specimen material	Dia. of indenter D mm	Applied load Kgf(F)	Diameter of indentation (d)mm		Average diameter (d)mm	Brinell Hardness Number	
				1	2	3		
1								
2								
3								

# **Calculation:**

$$\mathbf{BHN} = \frac{\textit{Load Applied (kgf)}}{\textit{sperical surface area of indentation}}$$

BHN= 
$$\frac{2P}{\pi D(D-\sqrt{(D^2-d^2)})}$$

**Conclusion:** The brinell hardness number of the given sample is found to be.....

C.V. RAMAN POLYTECHNIC, BHUBANESWAR	MECHANICAL ENFINEERING
C. V. MAMIAN I OL I ILCIINIC, BIIODANES WAR	WILCHAINICAL ENTINEERING

#### **EXPERIMENT NO.6**

# Aim of the experiment:

Determination of toughness by using impact testing machine (Izod /Charpy)

# **Theoretical background:**

Several engineering materials have to withstand impact or suddenly applied loads while in service. These loads are applied suddenly. The stress induced in these components is many times more than the stress produced by same load applied gradually. Therefore, impact tests are performed to asses shock absorbing capacity. Impact test signifies toughness of material that is ability of material to absorb energy during impact. Toughness takes into account both the strength and ductility of the material.

Two types of notch impact tests are commonly used.1. Charpy test 2. Izod test.


In Izod test, the specimen is placed as cantilever beam .The specimen have V shaped notch of 45°. The notch is located on tension side of specimen during impact loading.

In Charpy test, the specimen is placed horizontal simply supported beam. The specimen have V shaped notch of 45<sup>0</sup> at the centre of the length. The notch is located on tension side of the specimen during impact loading.

Energy absorbed in joules=initial energy in joules-final energy in joules

	Charpy Impact Testing	Izod Impact Testing
Materials Tested	Metals	Plastics & Metals
Types of Notches	U-notch and V-notch	V-notch only
Position of the Specimen	Horizontally, notch facing away from the pendulum	Vertically, notch facing toward the pendulum
Striking Point	Middle of the sample	Upper Tip of the sample
Common Specimen Dimensions	55 x 10 x 10 mm	64 x 12.7 x 3.2 mm (plastic) or 127 x 11.43 mm round bar (metal)
Common Specifications	ASTM E23, ISO 148, or EN 10045-1	ASTM D256, ASTM E23, and ISO 180

# **Experimental set up:**

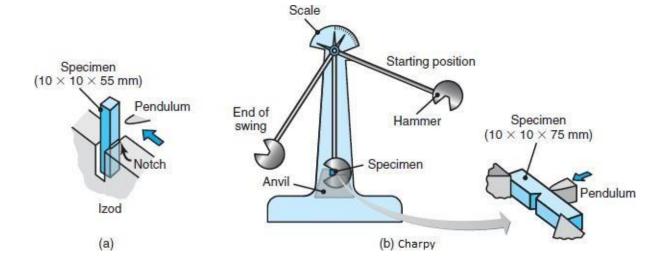

# **Resources required:**

Sl .no	Name of the apparatus	Specification
01	Impact testing machine	Maxcapacity:300J/170J,minimum scale graduation:0.5J,overallsize: 1.32m x 0.45m x 1.05m, net weight: 375kg, standard accessories, basic machine with hammer pipe, charpy and izod striker, protective railing, hand brake and stopper – 1set., digital display unit, caliper gauge for checking V notch, izod support for izod round specimen, self centering tong for quick and accurate setting of charpy test specimen.
02	Sample specimen	Mild steel, high carbon steel, dimensions given as in setup diagrams.
03	Vernier calliper	1.c=0.02
04	Tools and equipment used for specimen preparation and setting	Vice, hacksaw, files, gauges, players

# **Procedure:**

- 1. For conducting Charpy test, a proper striker is to be fitted firmly to the bottom of the hammer with the help of the clamming piece.
- 2. Bring the Hammer to its initial position of striking (140°) and strike without placing any specimen. Take the reading in digital indicator. This will give the initial energy reading. Keep in mind that there must be no person in the range of swinging hammer/pendulum. Apply pedal brake after one swing to stop the oscillation.
- 3. Bring back the hammer to its initial striking position again and lock it.
- 4. The prepared specimen of required dimensions is then placed horizontally on vice with the V notch facing opposite to the striking face of the hammer.
- 5. Then release the hammer for striking the specimen. Take the final energy reading. The difference between initial and final reading will give the actual energy absorbed.
- 6. Similar procedures can be followed for Izod test to measure the initial energy reading. Here hammer is released from 85<sup>0</sup>.
- 7. The specimen for Izod test is then firmly fitted in the specimen support with the help of clamping screw and élan key. Care should be taken that the notch on the specimen should face to pendulum striker.
- 8. After ascertaining that there is no person in the range of swinging pendulum, release them pendulum to smash the specimen. Carefully operate the pendulum brake when returning after one swing to stop the oscillations.
- 9. Note down the final reading and determine the actual energy absorbed.

The notch impact strength depends largely on the shape of the specimen and the notch. the values determined with other specimens therefore may not be compared with each other.

# **Precautions:**

- 1. Avoid improper handling of the equipment's.
- 2. Prepare the specimen exactly as per dimensions.
- 3. While locking the hammer pay extra care.
- 4. Whilereleasingthehammerforimpactmakesurethatthereisnopersonstanding around the machine.
- 5. Setthedigitaldisplayforeitherizodorcharpywhileperformingtherespectivetestings.

# **Observations:**

Sl. no	Energy absorbed by
	the Specimen (Izod
	/Charpy)

1	
2	
3	

# **Results:**

zod / Charpy impact value for specimen
no.1= Izod /Charpy impact value for specimen
no.2=
[zod /Charpy impact value for specimen no.3=

# **Conclusion:**

We successfully completed the above experiment and determine toughness by using impact testing machine .

# **EXPERIMENT NO.7**

# **Aim of the experiment:**

Determination of flash point and fire point

# **Theoretical background:**

#### Flash Point: -

The flash point of any fuel is the lowest temperature at which it can vaporize to for man ignitable mixture in air. At flash point the vapor may easy to burn the source of ignition is removed. The flash is not to be confused with auto ignition temp. Which does not requires an ignition source.

#### Fire Point: -

The fire point of a fuel is the temperature at which it will continue to burn for at least 5 sec. After ignition by an open flame, fire point can be assumed to be about 10° C higher than the flash point.

The flash and fire points of a liquid fuel specimen are the indicators of its flammability. In general, flash point is the lowest temperature of the test specimen, corrected to a barometric pressureof101.3kPa, at which the application of an ignition source causes the vapor of the test specimen to ignite momentarily and the flame to propagate across the surface of the liquid under the specified conditions of test. It is important to realize that the value of the flash point is not a physical constant but is the result of a flash point test and is dependent on the apparatus and procedure used. Fire point may be considered as the lowest temperature of the liquid at which vapor combustion and burning commences. A fire point happens when an ignition source is applied and the heat produced is self-sustaining, as it supplies enough vapors to combine with air and burn even after the removal of the ignition source.


Flash and fire point in engine perspective Gasoline has a flash point around -43° C whereas diesel has flash points higher than 52° C. Lower flash points are the indicators of good flammability and volatility. Therefore, gasoline makes faster vapour formation than diesel and instantly catches fire when spark, an external flame source, is provided. However, as its auto ignition temperature is high (in low compression ratio gasoline engine perspective), which is in the order of 247-280° C, it does not ignite prematurely due to the residual heat generated during compression stroke and heat transfer from wall. On the contrary, the higher flash point of diesel indicates poor vaporization tendencies and lesser tendency to ignite subjected to external flame source. However, as the auto ignition temperature of diesel is low (in high compression ratio diesel engine perspective), which is in the order of 210°C, diesel auto ignites easily with the residual heating during compression stroke and heat transfer from wall without the need of an external flame source such as spark plug. Poor vaporization tendency of diesel is dealt with in- cylinder swirl and high pressure injection.

Vegetable oils have significantly high flash points which are in the order of diesel fuels and higher. Hence their vaporization and mixing area huge challenge for direct engine applications. Therefore, vegetable oils are transesterified to produce fatty acid methyl lesters or bio diesel which has comparable flash point for direct compression

ignited diesel engine application. In the alcohol category, methanol has a flash point of around 12° C and auto ignition temperature of 470° C. Similarly, ethanol has 16° C flash point and auto ignition temperature around 365° C indicating their close proximity to gasoline fuel and potential alternative fuel application in spark ignited engines.

# **Apparatus and consumables required:**

- a) A Pensky-Marten's flash point apparatus.
- b) Thermometer of suitable range.
- c) Test samples.

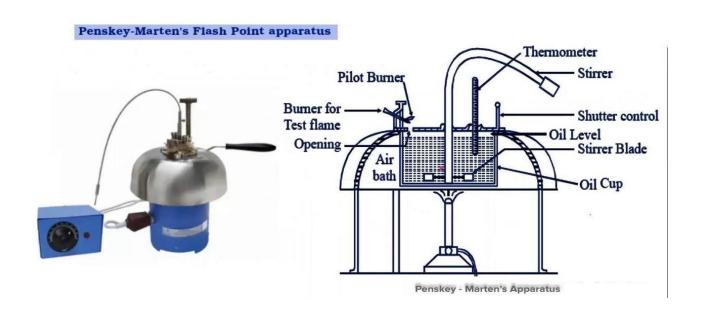

# **Preparation of samples:**

- a) Samples should be in reasonably fluid state before testing. For asphalts and other viscous materials, preheating should be done to ensure fluidity before testing.
- b) Samples may be warmed with constant heating rate. However, under no circumstances, should be heated above a temperature that lies 16° C below the expected flash point.

c) Samples containing dissolved water may be dehydrated with calcium chloride or by filtering through a suitable filter paper. If the same is not done, its consequence on experimental results an repeatability should be duly inferred.	
- · ·	

# **Procedure:**

- 1. Clean and dry all parts of the cup thoroughly.
- 2. Fill the cup with the sample to be tested to the level indicated by the filling mark.
- 3. Place the lid on the cup and set the latter on the stove.
- 4. Insert the thermometer and supply heat with the help of the rheostat switch to ensure temperature rise rate not more than 5 to 6° C per minute.
- 5. Turn the stirrer with 90 to 120 rpm in a down ward direction.
- 6. Provide the test flame time to time and start nearly 17° C below the expected flash point of the sample with 0.5 to 1° C gap.
- 7. Lower the test flame to the vapour space of the cupfor5sand allow it to be there for1s. Afterthat move the test flame up as quickly as possible and shutdown the lid for vapour build up.
- 8. Do not stir the sample while providing the test flame.
- 9. Denote the flash point and fire point accordingly.

# **Observations:**

Types of fuel	Flash point	Fire point
Petrol		
Diesel		
Kerosene		

# **Conclusion:**

Above experiment was successfully completed.

# **EXPERIMENT: 8**

# **Aim of the experiment:**

To Study the equivalence of Electric and heat energy and to determine the mechanical equivalent of heat by Joule's Calorimeter.

#### Theory:

If a Current I in Amp. passes through a resistance R ohm for time t sec, the electric energy dissipated is given by

$$W = I^2 R t = V$$
. I. t Joules  
Further 4.2 J = 1 Calorie or 1 Joule = 1/4.2 Calorie  
Heat Produce (W) = V.I.T./4.2 Calorie...... (i)

If  $M_1$  is the mass of Calorimeter with stirrer and  $M_2$  is the mass of water in it, C is the specific heat of copper and Q is the rise in temp of Calorimeter & water, then amount of heat produced is given by  $Q = M_1C \theta + M_2\theta$  ....... (ii)

From eqn. (i) and (ii) So **W** should be equal to **Q** within experimental error.

(b) Electrical energy dissipated

```
W = V.I.T. Joules
Heat absorbed = (M_1C\theta + CM_2\theta) Calories
Mechanical equivalent of heat (J) = W/Q = V.I.T./M_1C \theta + CM_2\theta J/Cal
```

# Procedure:

- 1. Draw the circuit diagram as shown in Fig. (1)
- 2. Remove the lid from the Calorimeter and find the mass  $(M_1)$  of Calorimeter with stirrer.
- 3. Fill Two third of the Calorimeter with water and again find the mass of Calorimeter with stirrer along with water. Let it be M. Hence mass of water taken is equal to  $M_2 = (M M_1)$
- 4. Replace the lid on the Calorimeter. Fit the thermometer in the hole provided for it. Place the Calorimeter in the constant temperature enclosure.
- 5. Connect the battery (**Be**), Rheostat ( $\mathbf{R_h}$ ), Key ( $\mathbf{K}$ ), ammeter ( $\mathbf{A}$ ) and voltmeter  $\mathbf{V}$  with connecting wires as shown in the Fig. (1)
- 6. Note the least count and zero error of the ammeter & voltmeter if any and put the contact of rheostat in the middle.
- 7. Find the initial temperature of water.
- 8. Put the plug in the key and start the stop watch. Temp of water starts rising. Keep on stirring the water. Note the reading of Ammeter and voltmeter and keep it constant with rheostat if it changes.

- 9. Go on taking the reading of Ammeter and voltmeter after every two minutes. Allow the current to pass for 10 minutes. Remove the plug from the key and note the final reading in the thermometer.
- 10. Continue to stirrer the water and allow it to cool down for the same time 10 minutes for which the current was passed. Again not the reading of thermometer.

#### **OBSERVATIONS:**

Mass of Calorimeter & stirrer  $(\mathbf{M_1}) = \dots (gm)$ Mass of Calorimeter & stirrer and water  $(\mathbf{M}) = \dots (gm)$ Mass of water  $(\mathbf{M_2}) = (\mathbf{M} - \dots \mathbf{M_1}) = \dots (gm)$ Initial temp of water  $\Box_1 = \dots \Box_0$ C Least count of ammeter  $= \dots A$ Least count of voltmeter  $= \dots V$ Zero correction of ammeter  $= \pm \dots A$ 

S. No.	Time in Min	Ammeter Reading		Voltmeter Reading	
		Observed in A	Corrected in A	Observed in V	Corrected in V
1	0				
2	2				
3	4				
4	6				
5	8				
6	10				
7	12				
8	14				

Mean Current I = .........A Mean potential difference V = ......VTime for which current pass t = ......min. ......Sec. Final temp of water  $\theta'_2$  = ......0C

Temp of water when allowed to cool for time (t),  $\theta_2$ " = .........0C

Corrected final temp  $\theta_2 = \theta'_2 + \frac{1}{2} (\theta_2' - \theta_2'') = \dots 0$ C

Specific heat of copper (c) = Cal g  $^{--1}$   $^{0}$ C $^{--1}$ 

Rise in temp.  $\theta = \theta_2 - \theta_1 = 0$ 

Electric energy dissipated W = V I t J

= V.I.T./4.2 Calorie

= ......Calorie

Heat absorbed by calorimeter and water

$$\theta = M_1C\theta + M_2\theta = \dots$$
Calorie

# **Result:** Within experimental error W $\cong$ Q

Calculation of Mechanical equivalent of heat

$$J = \frac{W}{Q} = \frac{V.I.T.}{M_1C\theta + M_2\theta} = J Cal^{-1}$$

#### PRECAUTIONS:

- 1. The connections should be neat, clean and tight.
- 2. Water in Calorimeter should be continuously stirred.
- 3. The coil should be completely immersed in water and current in the circuit should be kept constant.
- 4. Radiation correction should be applied.
- 5. The coil should not touch the Calorimeter.
- 6. Rise in temperature should be about  $10^{\circ}$ C

# To find the specific heat capacity of the given liquid.

$$J = V. I. T. / M_1 C\theta + M_2\theta C = J Cal^{--- 2}$$

Suppose **V** = Voltmeter Reading = 4 Volts

I = Ammeter Reading = 1 Amp.

t = time of passage of current = 600 seconds

M<sub>1</sub> = Mass of Calorimeter & Stirrer

$$= 83.60 \times 10^{-3} \text{Kg}.$$

M = Mass of Calorimeter, Stirrer & Water

$$= 193.73 \times 10^{-3} \text{Kg}.$$

$$M_2 = M - M_1 = Mass of Water$$

= 
$$(193.73 - 83.60) \times 10^{-3} = 110.13 \times 10^{-3} \text{ Kg}$$
.

 $\theta_1$ = Initial Reading of Calorimeter & contents

$$= 302.2^{\circ}C$$

 $\theta_2$ = Initial Reading of Calorimeter & contents

$$= 307.1^{\circ}C$$

Rise in temp. 
$$\theta = \theta_2 - \theta_1 = 307.1 - 302.2$$
  
= 4.9 K

Using above values, one can find the value of J					
Conclusion:					
rom the above experiment we successfully conduct the Joule's experiment.					
C.V. RAMAN POLYTECHNIC, BHUBANESWAR	MECHANICAL ENFINEERING				

C.V. RAMAN POLYTECHNIC, BHUBANESWAR	MECHANICAL ENFINEERING